
## **Technical Bulletin**

Number	P013
Subject	Recommissioning Sanyo/Panasonic ECO-I Systems
	following compressor change
Date	15 October 2015

In order to open all the valves to ease the recovery of refrigerant, pressure test and vacuum the "AP" pins on the Outdoor PCB need to be shorted out prior to power being applied.

- 1) Power down
- 2) Remove **OPEN/SHORT** bridge connection from **OPEN/SHORT** position on PCB
- 3) Apply OPEN/SHORT bridge connection to AP Pins
- 4) Power up
- 5) This will enable all Condensing Unit and Indoor Unit valves to be fully open.

## **BEFORE**

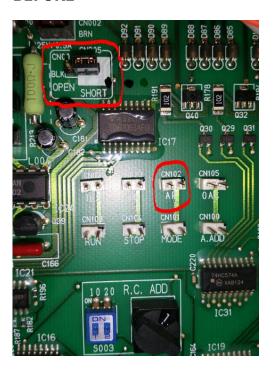

## **AFTER**

